

Work Order ID 83058

83058

Page 1

April-12-12 1:30:41 PM

Item ID: D212-664-101

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Fwd

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/04/12 Tooling:

Date:

Run Start *NR1*

QC:

Date: SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D212-664-141	Rev D (DEO)
--------------	-------------

100

100

DOCUMENT CONTROL

0.00

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D212-664-101 - ~~CHG005~~

MLJ 12/05/02

110

110

Pick Kit

0.00

Packaging

Memo

0.00

Packaging

Packaging

MO
12-4-12

120

120

BENDING MACHINE - CROSSTUBES

0.00

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101

MO
12-4-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83058

83058

Page 2

April-12-12 1:30:41 PM

Item ID: D212-664-101

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 12/04/2012 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130 QC15- Crosstube Dimensional Check

0.00

130

QC Memo

0.00

Quality Control

140

0.00

140

Crosstubes Crosstubes

Memo

0.00

Crosstubes

1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10

2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141

4-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141

JW

JW

12-04-16

12-04-17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83058

83058

Page 3

April-12-12 1:30:41 PM

Item ID: D212-664-101

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150	Crosstubes Chemical Conversion	0.00							
150									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	Chemical Conversion Coat within 24 hours of bending and drilling								
160	QC5- Inspect part completeness to step on W/O	0.00							
160									
QC	Memo	0.00							
Quality Control									
170	Outsource process - NDT per QSI038 4.1	0.00							
170									
Outsource2	Memo	0.00							
Outsource process - NDT	Liquid Penetrant Inspection as per QSI 038 Issue P/O: <u>16780</u> LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order								

JW

12-04-12

8/26/12

CL 12/04/2010

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83058***83058***

Page 4

April-12-12 1:30:41 PM

Item ID: D212-664-101

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Fwd

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	Receive & Inspect for Damage & Mat'l Certs	0.00							
180	Packaging								
Packaging	Memo	0.00							
Packaging	Ensure copy of NDT results attached to work order.								
190	QC5- Inspect part completeness to step on W/O	0.00							
190									
QC	Memo	0.00							
Quality Control	Inspect for damage & ensure results are as per Dwg D212-664-141								

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83058***83058***

Page 5

April-12-12 1:30:41 PM

Item ID: D212-664-101

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Fwd

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200	Spray Painting per QSI005 4.2	0.00							
200	SprayPaint								
Spray Painting	Memo	0.00							
	1-Prime inside and outside crosstube as per QSI 005 4.2								
	2-Paint outside crosstube as per DEO D212-667-141 with White Imron as per QSI 005 4.2								
	PRIME: 120133								
	Start Time: 7:45								
	Finish Time: 8:30								
	PAINT: 120985								
	Start Time: 4:00								
	Finish Time: 5:00								
210	QC14- Inspect Spray Paint	0.00							
210									
QC	Memo	0.00							
Quality Control	Then, Wrap in plastic bag to protect from scratches								

12-4-26 120

12-04-27 (3)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D212-664101 PAR #: _____ Fault Category: Landing Gear / cross tube NCR: Yes No DQA: Not Date: 12/05/14
 Resolution: Re work Disposition: Re work QA: N/C Closed: OK Date: 12/5/14

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
12/14/13	#200	while working on the weekend employee didn't have the w/o's Back from NCR + Re-work. And painted the complete tubes while forgetting about the repeats.		- Strip entire tube Primer + Inven. Re Prime + Paint As per AS2005 4.2. + Deg.	AS 12-4-24	12-04-27	W	S 12/14/13
		welding on the Bottom Bottom of the Bend R.C.						S 12/14/13

NOTE: Date & initial all entries

Work Order ID 83058

83058

Page 6

April-12-12 1:30:41 PM

Item ID: D212-664-101

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 12/04/2012 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220		0.00							
220	Crosstubes								
Crosstubes	Memo	0.00							
Crosstubes	1-Abrade mating surfaces of support and crosstube with 400 grit sandpaper, clean the area with 4105S wash 'n' wipe								
	2-Install supports with Proseal 890 per DSI9563 and QSI 015 A/R Proseal 890 Batch: <u>121287</u>								
	3- Torque bolts as per dwg								
230	QC6- Inspect dimensions to drawing	0.00							
230									
QC	Memo	0.00							
Quality Control									
240	Pick Kit	0.00							
240									
Packaging	Memo	0.00							
Packaging									

AS 12-4-27

nl 12-04-30 (1)

12/5/28

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83058***83058***

Page 7

April-12-12 1:30:41 PM

Item ID: D212-664-101

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

250

QC4- 100% Inspect kits for completeness

0.00

250

QC

Memo

0.00

Quality Control

260

Packaging

0.00

260

Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D212-664-101

270

QC21- Final Inspection - Work Order Release

0.00

270

QC

Memo

0.00

Quality Control

IX

12-05-08

MCJ 12/05/04

MF 12-05-04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

April-12-12 1:30:45 PM

Page 1

Work Order ID: 83058

83058

Parent Item: D212-664-101

D212-664-101

Parent Item Name: Crosstube Fwd

Start Date: 12/04/2012

Required Date: 26/04/2012

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP Rev:E04.02.16ReformatKJ/DS

IPP Rev:F 06-03-29 Remove Coments on Pick List JLM

IPP Rev:G 07-04-30 As per Rev C JLM

IPP Rev:H

11.04.26 inspection strip ecn 11-549 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D212-664-101TRN		Manufactured	No			110	Each	7.0000	1	1			

D212-664-101TRN

Crosstube Turning Detail

**

Location	Loc Qty	Loc Code
FG046	3	
68584	0	
81140	1	
81141	1	
82577	1	
LG	4	
81812	1	
82574	1	
82575	1	
82576	1	

D3595-063-450

Manufactured No

230

Each

83.8095

4

4.210526

D3595-063-450

RUBBER CUSHION

**

Location	Loc Qty	Loc Code
LG051	73.7	
80161	73.7	
MAT052	10.109474	
67353	2	
68893	6	
70113	0.56	
71354	0.2	
74113	0.349474	
75597	1	

MVO 12-4-12

AB 12-4-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

: Picklist Print

April-12-12 1:30:45 PM

Work Order ID: 83058

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd

83058

D212-664-101

Start Date: 12/04/2012

Required Date: 26/04/2012

Start Qty: 1.00

Required Qty: 1.00

MS21920-25

Purchased

No

220

Each

133.0000

4

4

MS21920-25

Clamp(per MIL-DTL-8783C)

**

AS 12-4-27

Location

Loc Qty

Loc Code

LG050

133

116264

2

117998

4

118142

4

119339

2

119746

2

120475

19

120920

100

D2893-1

Manufactured

No

220

Each

10.0000

2

2

D2893-1

2.75 Support

**

AS 12-4-27

Location

Loc Qty

Loc Code

LG052

10

72865

2

76250

1

82228

7

D3428-1

Manufactured

No

240

Each

31.0000

1

1

D3428-1

Placard

**

12/5/27

Location

Loc Qty

Loc Code

ST042

31

78933

14

81881

17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

April-12-12 1:30:45 PM

Work Order ID: 83058

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd

83058

D212-664-101

Start Date: 12/04/2012

Required Date: 26/04/2012

Start Qty: 1.00

Required Qty: 1.00

AN6-35A

Purchased

No

240

Each

106.0000

4 4

**

AN6-35A

BOLT

Location

Loc Qty

Loc Code

342

50

121181

50

ST342

56

120187

56

AN6-36A

Purchased

No

240

Each

116.0000

4 4

**

AN6-36A

Bolt

Location

Loc Qty

Loc Code

ST342

116

118422

2

119449

1

120187

13

120423

100

MS21042L6

Purchased

No

240

Each

790.0000

6 6

**

MS21042L6

Nut

Location

Loc Qty

Loc Code

ST300

790

117677

25

118384

3

118927

48

119075

514

120308

200

AN960JD616

NAS1149D0663J

Purchased

No

240

Each

0.0000

18 18

**

AN960JD616

Washer

1121243 12/5/25

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	83058
Description: Crosstube High Fwd (205/212/412)		Part Number:	D212-664-101
Inspection Dwg: D212-664-141 Rev: D		Page 1 of 1	

Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7

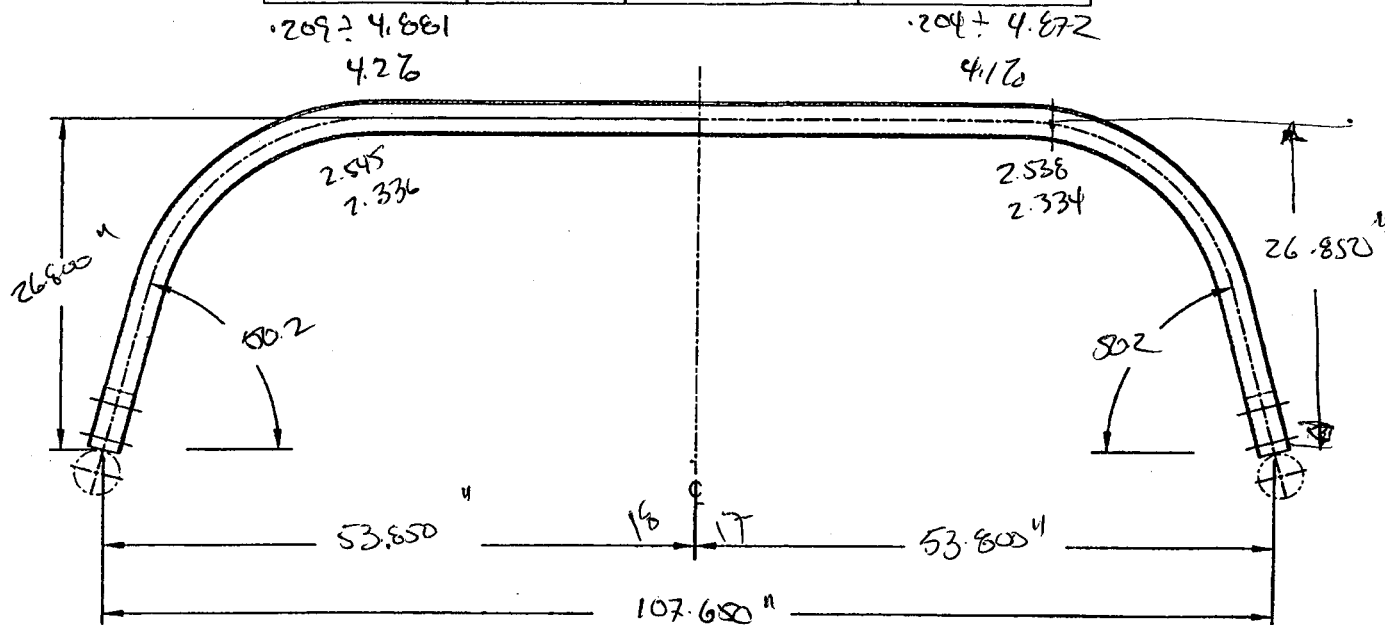

Comments
Side A = 4.276 crush @ 18 passes
Side B = 4.176 crush @ 17 passes

QC15 Inspection	S
Date	12/04/03

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.31	Dimensions updated per Dwg Rev C	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -141	Qty -141B	Part Number	Description
1	X		D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X	D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3	1	1	D6005-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS
- WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)
D212-664-141B = 33.6 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS
6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF
D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER
INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE
SUPPORT.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE
SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR
DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND
MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT
HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 83058 MWS

REMOVED FROM UNDER REVIEW PER
ECN# 11-614
21.07.26
FOR PROTECTING SURFACES

DEO ATTACHED

RELEASED
2009-10-29
M

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-141	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMBOD OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

8 7 6 5 4 3 2 1

03058

12 13 15
D2893-1 SUPPORT
MS21920-25 CLAMP, 2X
D3595-063-450 RUBBER CUSHION, 2X
2 PL.

A4-2

A

14.00 (-141)
OR 13.75 (-141B)



D212-664-501
BENT TUBE

SYM

D212-664-141/-141B
ASSEMBLY DETAIL




020411-614
1.07.20
UNDER REVIEW
09.09.30

DEO ATTACHED

RELEASED
2009-10-29

D2893-1
SUPPORT, REF
12
APPLY MAGNOBOND
BETWEEN D2893-1 AND
CROSSTUBE
D3595-063-450
RUBBER CUSHION
UNDER CLAMP, REF
13 15
MS21920-25
CLAMP, REF

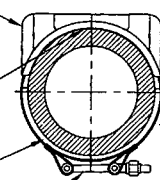

SECTION A-A DS-2
SCALE 4X

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-141	SHEET 2 OF 4
APPROVED	100	TITLE	SCALE
DE APPR.	11	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

83058

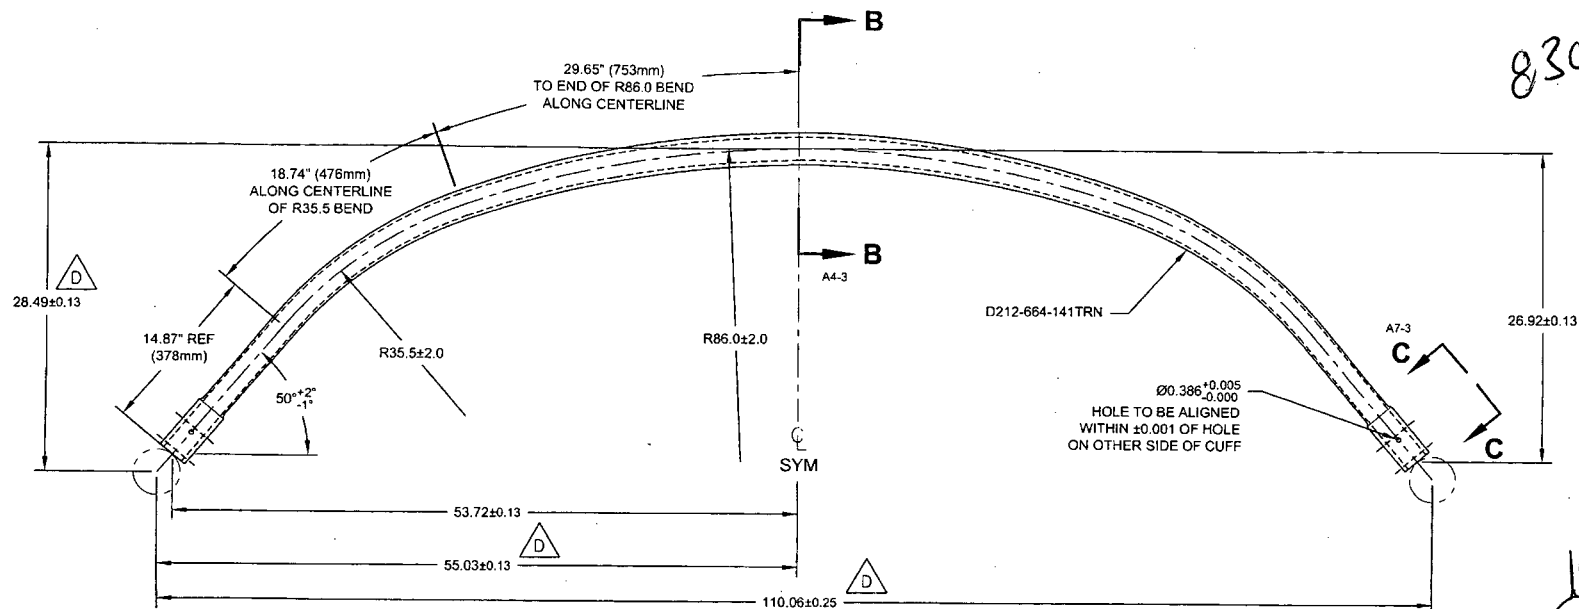

D212-664-501
BENDING AND DRILLING DETAIL


10

UNDER REVIEW


11.09.03

DEO ATTACHED

RELEASED
2009-10-29

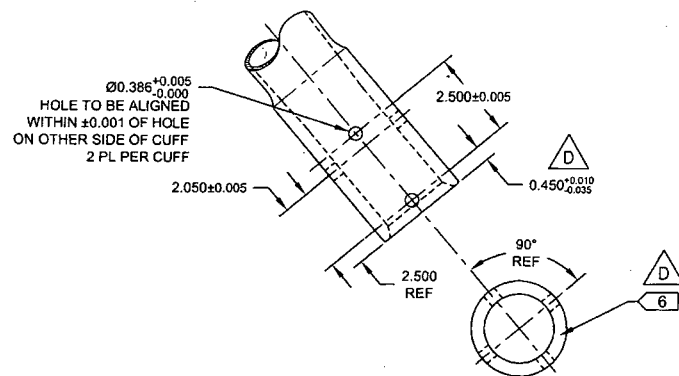

VIEW C-C: CUFF DETAIL
SCALE 3X

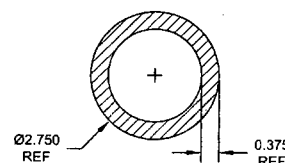

SECTION B-B
SCALE 4X

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-141	SHEET 3 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	HT	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMBINE OR COMMERCIALIZED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector



Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

83050

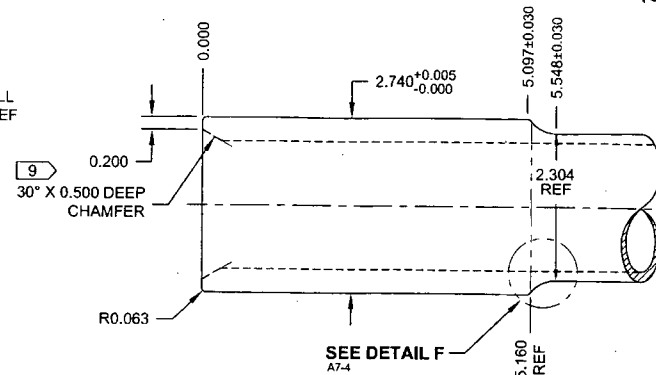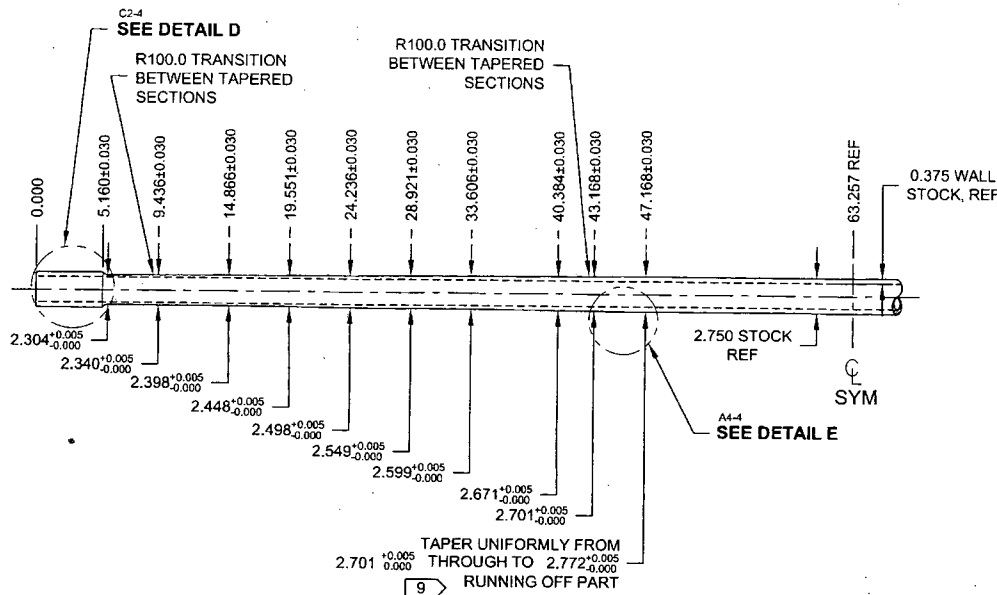


DETAIL D:
 CROSSTUBE CUFF D8-4
 SCALE 5X

D
 D212-664-141TRN
 TURNING DETAIL

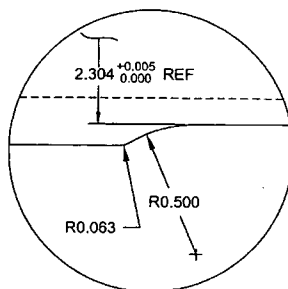

DETAIL F:
 CUFF TRANSITION C2-4
 SCALE 10X

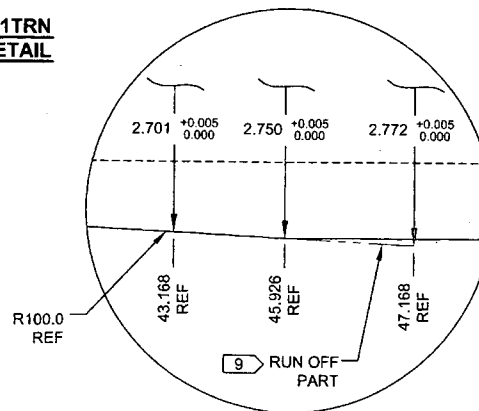

DETAIL E:
 TAPER RUN-OFF C5-4
 NOT TO SCALE

UNDER REVIEW

11.06.13

DEO ATTACHED

RELEASED

2009-10-29

MP

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. D
MFG. APPR.	SS	D212-664-141	SHEET 4 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	TH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COMMUNITIES TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

93058

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>CP</i>	MFG. APPR. <i>E</i>	APPROVED <i>WAD</i>	DE APPR. <i>WAD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		


IS:

WAS:


UNDER REVIEW

CP 11/06.13

*ECN# 11-614
11.07.28*

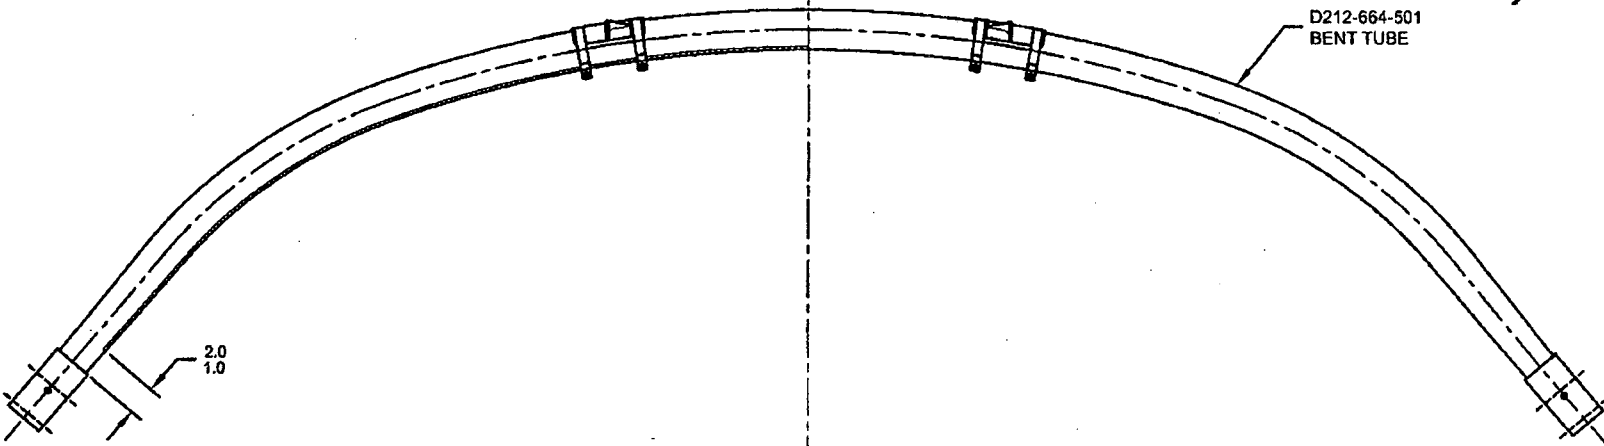

**D212-664-141/-141B
ASSEMBLY DETAIL**

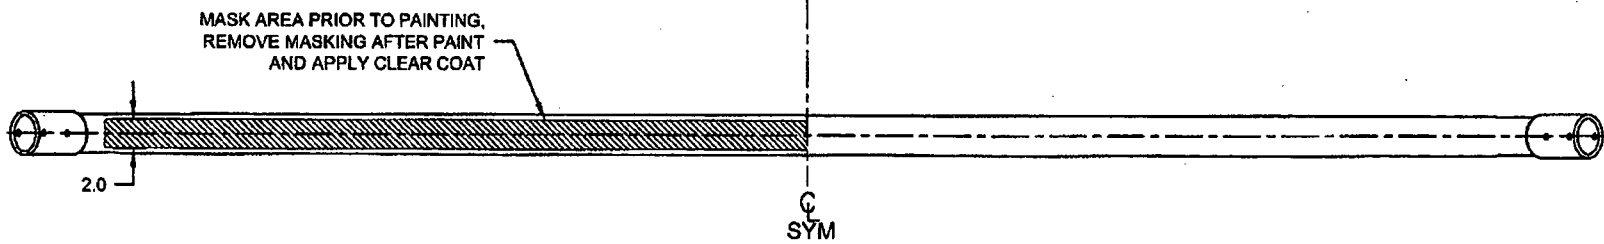

COPYRIGHT © 2011 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D212-664-141	TITLE CROSSTUBE ASS'Y (205 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>AB</i>	APPROVED <i>MD</i>		DE APPR. <i>TH</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -141	Qty -141B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2893-1,SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
MD

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



LIQUID PENETRANT TEST REPORT

P- 05643

CLIENT

ATTENTION

ADDRESS

PROJECT

ITEM(S) EXAMINED

DATE

ACUREN JOB NO.

PO/NO.

WORK LOCATION

ACCEPTANCE STD.

PAGE

OF

TIME

AM

PM

JOB DESCRIPTION

PROCEDURE NO. LT-002 REV./DATE 2012

TECHNIQUE NO. LT-002 REV./DATE 2012

PART NO.

MATERIAL

THICKNESS

SCOPE

TEST DETAILS

METHOD	<input checked="" type="checkbox"/> FLUORESCENT	<input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> WATER WASH	<input type="checkbox"/> SOLVENT REMOVABLE	<input type="checkbox"/> POST EMULSIFIED
FAMILY BRAND	MAGNA FLUX		BLACK LIGHT S/N	16459	
PENETRANT	2167	MINIMUM DWELL TIME	45	MIN.	LIGHTING EQUIP.
PENETRANT REMOVER	1150	MINIMUM DRY TIME	>10	MIN.	OTHER
DEVELOPER	SKD 52	MINIMUM DWELL TIME	10	MIN.	LIGHT METER S/N
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS	<input type="checkbox"/> AQUEOUS	<input type="checkbox"/> DRY	CAL DUE DATE	

TEST SURFACE

SURFACE CONDITION	<input type="checkbox"/> AS GROUND	<input type="checkbox"/> AS WELDED	<input checked="" type="checkbox"/> MACHINED	<input type="checkbox"/> SHOT BLASTED	<input type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < - 4°C/ 20°F	<input type="checkbox"/> - 4°C/ 20°F TO 10°C/50°F	<input checked="" type="checkbox"/> 10°C/50°F TO 52°C/125°F	<input type="checkbox"/> > 52°C/125°F	

RESULTS- (☐ METRIC ☒ IMPERIAL)

ITEM #	COMMENTS	ACCEPTED	ITEM ID	STATUS
1	CRACKS NOID 83182	✓	ITEM ID: D412-664-203	AFT
2	" NOID 83183	✓	ITEM ID: D412-664-203	AFT
3	" NOID 83058 ✓	✓	ITEM ID: D212-664-101	FWD
4	" NOID 83059	✓	ITEM ID: D212-664-101	FWD
5	" NOID 81796	✓	ITEM ID: D212-664-101	FWD
6	" NOID 81797	✓	ITEM ID: D212-664-101	FWD
7	" NOID 81270	✓	ITEM ID: D212-664-101	FWD
8	" NOID 81270	✓	ITEM ID: D212-664-101	FWD

NO RELEVANT INDICATION WAS DETECTED AS PER APPLICABLE STANDARD AT THE TIME OF INSPECTION

8/17/12

Scope of Services: The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care: In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE

TECHNICIAN (SIGNATURE):

NAME (PRINT):

CGSB LEVEL

CGSB REG. NO.

1ST TECHNICIAN

SNT LEVEL

3049

CGSB LEVEL

CGSB REG. NO.

2ND TECHNICIAN

SNT LEVEL

DTR # E34989

REPORT

REVIEWED BY:

NAME

INITIALS

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY

PT Sept 2005

REFERENCE ONLY

5.0 PARTS LIST

5.1 HIGH GEAR CROSSTUBES

Item	-101	-201	-203	Part Number	Description
	X			D212-664-101	CROSSTUBE INSTALLATION, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
		X		D212-664-201	CROSSTUBE INSTALLATION, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
			X	D412-664-203	CROSSTUBE INSTALLATION, 412 HIGH AFT
1	1			D212-664-141	CROSSTUBE ASSEMBLY, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
2		1		D212-664-241	CROSSTUBE ASSEMBLY, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
3			1	D412-664-243	CROSSTUBE ASSEMBLY, 412 HIGH AFT
10	2			* D2893-1	SUPPORT
11	4			* D3595-063-450	RUBBER CUSHION
12	4			* MS21920-25	CLAMP (OR MS21042-26)
13	/ 4			AN6-35A	BOLT
14	/ 4			AN6-36A	BOLT
15	/ 6			MS21042L6	NUT (OR MS21042-6)
16	/ 18			AN960JD616	WASHER
20		2		* D2940-1	SUPPORT
21		4		* D3595-063-530	RUBBER CUSHION
22		4		* MS21920-28	CLAMP (OR MS21042-30)
23		4		AN6-40A	BOLT
24		2		AN6-41A	BOLT
25		6		MS21042L6	NUT (OR MS21042-6)
26		18		AN960JD616	WASHER
30			1	* D2896-1	SUPPORT
32			2	* D3595-063-570	RUBBER CUSHION
33			4	* MS21920-28	CLAMP
34			2	* MS21920-30	CLAMP (OR MS21042-32)
35			4	AN6-40A	BOLT
36			2	AN6-41A	BOLT
37			6	MS21042L6	NUT (OR MS21042-6)
38			18	AN960JD616	WASHER
39			2	* D3189-1	CHAFING SHIELD
50	/ 1	1		D3428-1	PLACARD

*REFERENCE ONLY. PARTS ARE INCLUDED IN D212-664-141/-241 OR D412-664-243 ASSEMBLIES ABOVE
NOTE: KITS INCLUDE EXTRA HARDWARE FOR COMPATIBILITY WITH BOTH DART AND BELL/AAI
SKIDTUBES.

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
12.05.03	200/ 210	Apply clear coat to entire of outside surface of crastubey except mask off area of support.				<i>JP</i> 12.05.03 051042	<i>5</i> 17/05/04

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries